
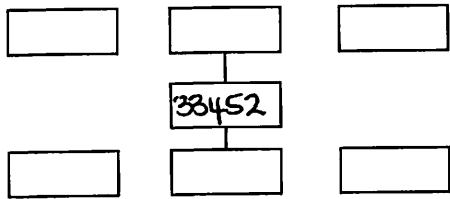


|   |  |   |                                  |
|---|--|---|----------------------------------|
| AREA:<br>KKT-E+   | GRID SQUARES: 201-J41, 201-J43<br>201-J42, 201-J44, 201-J45<br>201-K44, 201-K45, 201-K46, K47                              | INITIALS & DATE:<br>DCJ<br>19 APRIL 2014                          | FEATURE No.:<br>33452            |
| FEATURE TYPE (For example wall, staircase, bench, foundation structure, platform etc.):<br>WALL.  |  | Full extent visible in plan:<br>YES / (NO)                        |                                  |
| 1. Dimensions (in metres)   | Length:<br>30.47m  | Width:<br>0.90m   | Height:<br>1.58m                 |
| 2. Type of material(s) used   | WORKED LIMESTONE.  |   |                                  |
| 3. Coursing (form of construction)  | FAIRLY REGULAR COURSES OF LARGE STONES, WEDGED / HELD IN PLACE WITH SMALLER STONES. 4 COURSES CAN BE SEEN IN PHOTO 815416. |   |                                  |
| 4. Orientation  | NE/SW.   |   |                                  |
| 5. Associated collapse  | (34260) (34529) - NOT EXCAVATED.   |   |                                  |
| 6. Cut & fill feature #'s   | NOT KNOWN  |   |                                  |
| 7. Repaired?  | UNKNOWN  |   |                                  |
| 8. Associated floors  | "  |   |                                  |
| 9. Surface treatments? E.g. plaster, paint, mouldings   | MUDRENDER (34545) } NORTH & EAST FACING<br>MARL PLASTER (34039) } ELEVATIONS.  |   |                                  |
| 10. Size of one component   | LARGEST 0.50m (L) x 0.40m (W) x 0.28m (H)<br>SMALLEST 0.05m (L) x 0.04m (W) x 0.04m (H).                                   |   |                                  |
| 11. Bonding material  | SANDY CLAY.  |   |                                  |
| 12. Excavated   | Yes (No)   |   |                                  |
| Mini stratigraphic matrix<br>  |  | Abuts:<br>Abutted by:<br>Bonded into:<br>Contiguous with: (34075) | Same as:<br>Associated features: |
| Discussion and interpretation:<br><br>EXTENSIVE LIMESTONE WALL BORDERING THE NORTHERN SIDE OF BROAD STREET SPACE 11636. EASTERN LIMIT FUNCTIONS WITH THE WESTERN LIMIT OF LIMESTONE WALL (34075) FORMING AN OPENING TO SPACE 11638 TO THE NORTH. PARTIALLY EXPOSED IN 2012. FURTHER EXPOSED IN 2014. WESTERN LIMIT UNKNOWN AS STILL LOCKED UNDER CRUSHED LIMESTONE DEPOSITS FROM THE NORTH. |  |   |                                  |

Remember: do not just draw the architectural feature in isolation. Show how it relates to surrounding features and include details of surface treatments, repairs/modifications/damage, bonding material(s), and associated cuts. Annotate all aspects of the feature or use a Drawing Key. Measurements must be included for all aspects of the feature and surrounding features.


**Sketch Plan** - Include square numbers, North arrow, space numbers, and elevations.

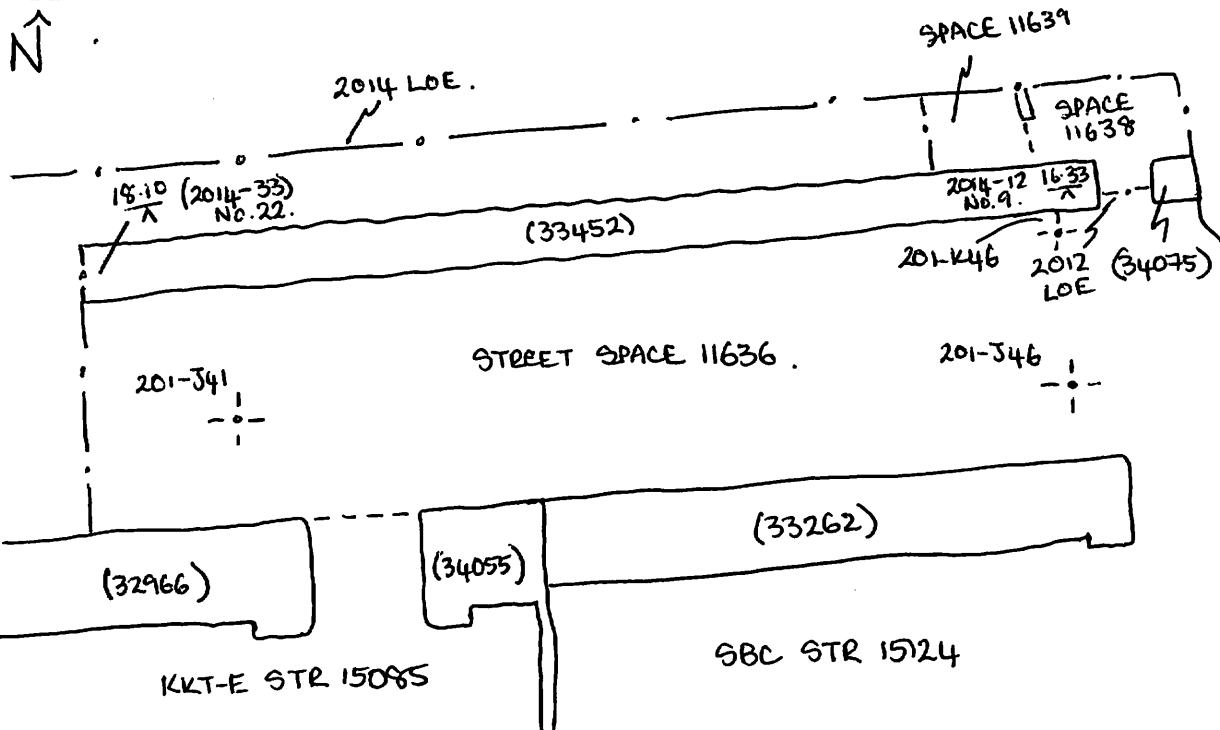

**Profile Sketch** - State direction the elevation of the feature being drawn is facing e.g. 'West Facing Elevation of Feature .... If feature was drawn in section then include the grid co-ordinates and elevations.

WEST

EAST

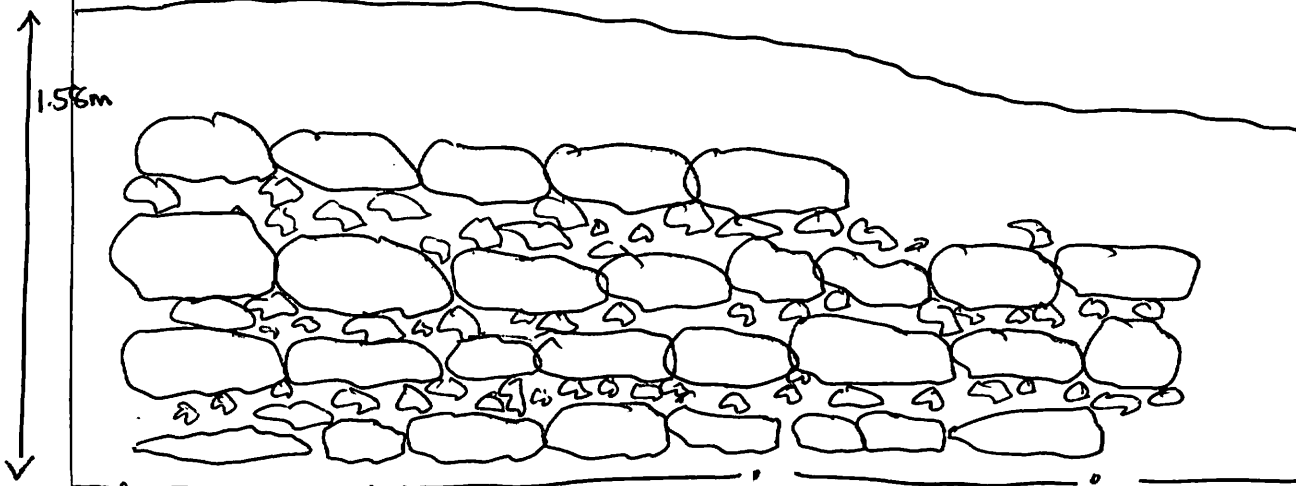

|  |   |
|--|---|
| Drawing No.'s: 2014-12, 2014-28, 2014-31, 2014-32, 2014-33, 2014-34, 2012-121. | Photo No.'s: 815405, 815406, 815416, 815416, 815418, 815419 |
| Space No.: 11636, 11638, 11639.  | Structure No.: /  |
| Matrix Group: 18227  | Matrix Phase:   |
| Samples taken:   | Sondage No.: /  |